

Reach - Information and Instruction Sheet

This stylish monitor arm, arguably one of the slimmest of its type on the market today, is available in silver, black and white and comes complete with quick release VESA, C clamp and through desk fixing kits as standard. The arm tension can be adjusted quickly using a simple Allen key system to support monitors ranging between 2kgs and 5kgs, which covers most popular brands.




Main features

1. Choice of silver, black or white.
2. Available as a single arm (fig. 01) and double arm (fig. 02).
3. Fixing kits include; C clamp and through desk as standard.
4. Comes with quick release VESA (black).
5. Includes cable management clips to secure cables to upper and lower arm sections.
6. Supports monitors up to 5kgs (5kg + 5kg for the Reach double monitor arm).




Dimensions

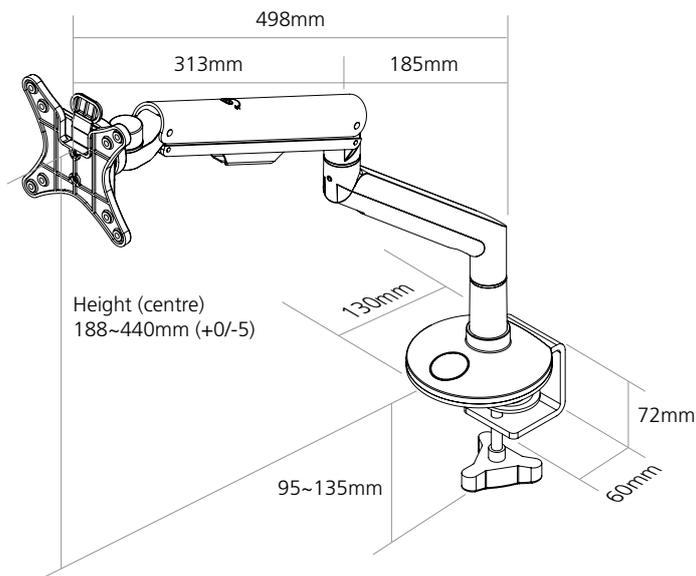

Single Reach Arm fig. 03



Contents

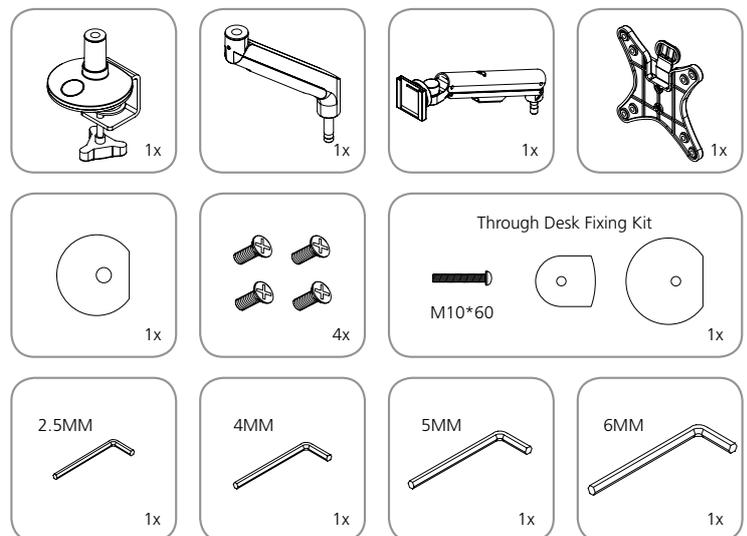

Reach - Information and Instruction Sheet

Fixing Instructions

1. The C clamp is pre-assembled in the box ready to install. To fit the C clamp push it tight against the edge of the desk and tighten the hand screw in a clockwise direction. Note: An EVA pad is included in the fixing kit to improve grip and protect the desk surface.
2. The lower arm section can then be installed into the C clamp by inserting the pin into the plastic collar, which is located at the top of the C clamp. Push gently to ensure the arm is seated correctly and secure by tightening the grub screw at the back of the C clamp with the Allen key provided.
3. The upper arm section can then be installed into the lower arm by inserting the pin into the plastic collar, which is located at the top of the lower arm. Push gently to ensure the arm is seated correctly and secure by tightening the grub screw at the top of the lower arm section.
4. The quick release VESA must be attached to the back of the monitor using the screws provided before sliding into position on the arm.
5. If through desk fixing is required, the lower part of the C clamp must be removed from the C clamp spreader. To do this simply remove the bolt from the underside of the C clamp.
6. The through desk fixing kit includes an M10 bolt, a C clamp spreader filler plate and an under desk spreader plate. To fix, a 10mm hole must first be drilled through the desk. The C clamp spreader and filler plate should then be positioned on the desk (a pre-cut EVA pad is also included to protect the desk surface) so that the under desk spreader plate and M10 bolt can be secured from beneath the desk. Tighten using the Allen key provided.

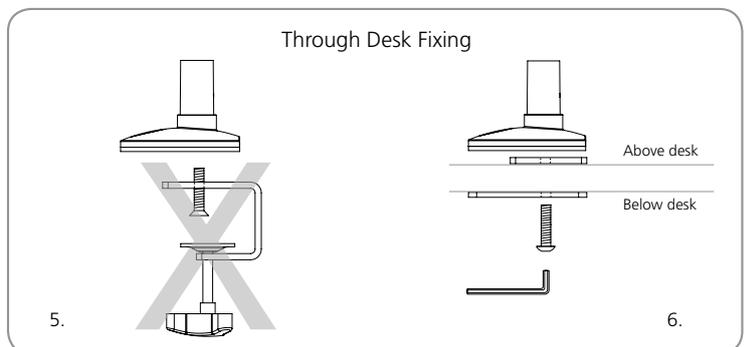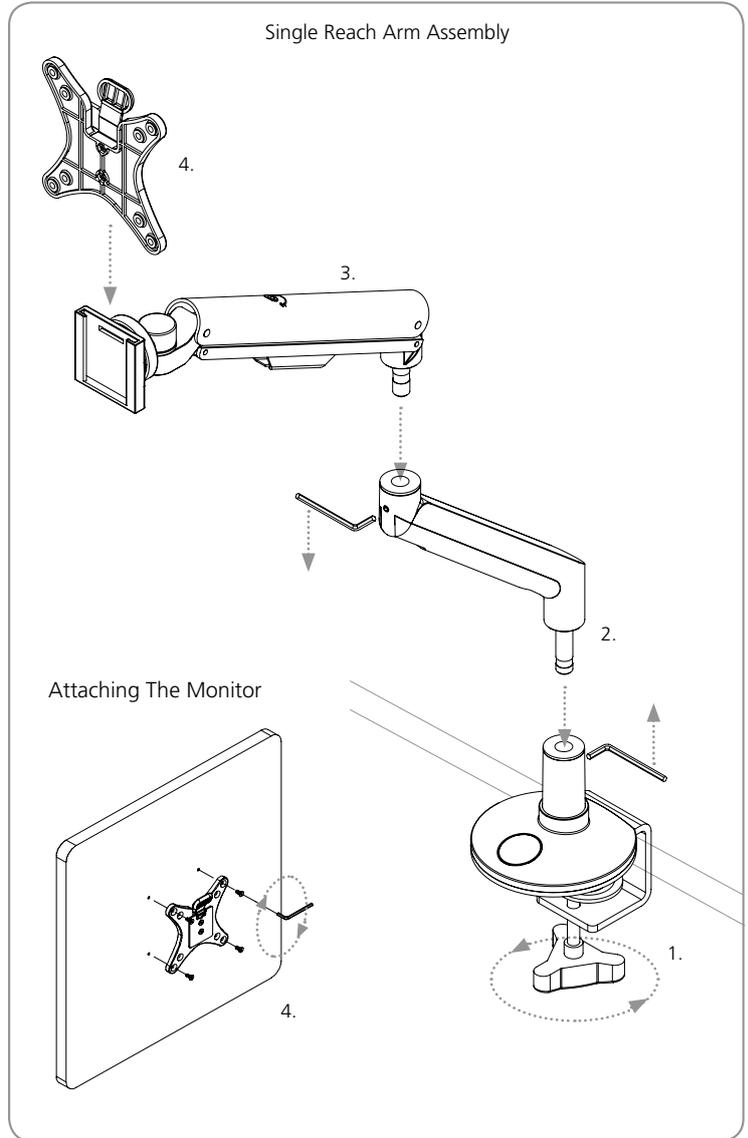

Cleaning, Storage and Maintenance

Service Components	Available to order.
Cleaning & Maintenance	Dry cloth, no abrasives or solvents to be used on the module surface.
Handling & Storage	Do not drop.

Warning

Do not exceed the recommended maximum weight.

We recommend using the pre-cut EVA pad to improve grip and protect the desk surface.